onsulting Engineering - Surveying J. Baz 689

-282-1004

21-622-2905

Official Survey Record

THAYER _ COUNTY, NEBRASKA

Page 1 of 12

Survey	No		••••	(To	be as	signe	ed by	z Co	unty Surv	eyor)
		**********		Sect	ion	T	1 N,	R	1&2 66 3 6 6th	P.M.
Survey	of: Perpetuate	Land Co	orners	in T11	I – R 1&	2&3W	I			•••••

Date 1-18 thru 11-120 02 Weathe North 1/4 Corner Section 36-T1N-R3W Weather Cloudy and Cold Found Aluminum Cap at surface on a 5/8" X 3" Rebar. Found 1" X 19" Rebar 11" deep. Found 1" Bar 31" deep. Set Magnet on lower 1" Bar. Lowered 1" X 19" Rebar and Aluminum Cap on 5/8" Rebar to 30". Aluminum Cap is 0.11' South and 0.05' East of lower 1" Bar. 1" X 19" Rebar is 0.18' South and 0.05' West of lower 1" Bar. After construction, set 5/8" X 24" Rebar to grade at surface of Asphalt with Aluminum Cap marked


> THAYER COUNTY 2002 GC T1N R3W 25 36 SECTION CORNER

with temporary ties as follows.

WSW 177.03' to nail and shiner North side power pole 134.77' to nail and shiner NE side power pole SE 79.80' to top NE corner concrete right of way marker 60.01' to top SE corner furthest North concrete right of SSW N way marker 67.10' to 5/8" X 24" rebar with tag "RM WW87" 59' North of NΕ centerline highway 45' East of right of way markers 71.98' to 5/8" X 24" rebar with tag "RM WW87" 59' North of NWcenterline highway 54' West of right of way markers ' to centerline Highway 8 Field Notes:

Show descriptions of corners found and restored; distances chained; angles measured, if any; courses and bearings of irregular tracts surveyed; and ties taken to corners. Use reverse side if necessary.

I hereby certify that I have caused to be Perpetuated Land Corners in TiN-R1&2&3W. Iron Stakes were set at all points shown thus ullet on the annexed plat. All distances are given in feet and decimals thereof.

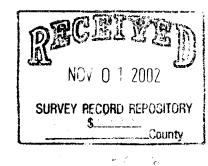

Surveyor's license No. L.S.

MAM L.

22nd 📆 October 02 Signed this..., day of...... Mun Name: 297

Land Surveyor's Seal